



Occupational Health & Safety - Report 25 Bay Sample St Port Melbourne VIC 3207

- √ 30+ Years' Experience In Reporting Services
- ✓ Our Quality Reports Make Roscon The Number #1 Choice
- ✓ We conduct onsite audits including photos, not desktop audits
- ✓ ISO 9001 Accredited Systems & Procedures
- ✓ Member MBAV Platinum Master Builder (5630)
- ✓ Member Strata Community Australia
- ✓ Member Australian Institute of Project Management



Roscon Property Services

Roscon Property Services is the first property services provider to introduce central streamlined systems integrating property maintenance and quality controlled reporting services accredited by International Certifications, dedicated to support Owners Corporation managers.

Since 1987 we have evolved from our history of developing and constructing prestigious residential and high profile commercial/ industrial landmark projects. We have extended our service capabilities through our extensive construction, strata management and professional property services experience gained over 25 years, and filled the void between three property industries.

Built on solid foundations our clients rest assured in the comfort of knowing they're supported by Registered Building Practitioners, qualified professionals, fully insured and committed in protecting their responsibility to valued clients.

Mission Statement

"It is the policy of Roscon Property Services to deliver property Maintenance services to its clients in the most efficient and timely manner while respecting legal and statutory requirements. Roscon Property Services Pty Ltd operates under ISO 9001-2000 in the completion of its services. All staff & sub-contractors are expected to work according to our policies and procedures. The system employed by Roscon Property Services Pty Ltd is reviewed annually in order to ensure its consistency".

Instructed By

Name	Ben Peter
Company	SampleCorp Pty Ltd
Title	Director
Address	150 Sample Rd Coburg VIC 3058

Inspected & Compiled by

Inspector ID PRA - 158













July 14, 2014

Dear Ben,

Thank you for using Roscon Property Services Pty Ltd for your safety inspection and report. I have attached a copy of the report that has been compiled by an experienced auditor.

Part 1	A safety report that denotes the various areas, within the property, and a comment as to the general safety of those areas.
Part 2	A contractor's safe working agreement, which is signed prior to the commencement of any works, by a subcontractor. Having a contractor sign the agreement ensures that the contractor is aware of the responsibilities under the Occupational Health & Safety Act and will assist the Owners Corporation to discharge their duties under the OH&S Act.
Part 3	Sub Contractors Application, to give a clear understanding of the skills and capabilities of the contractor.
Part 4	Safety Inspection notation sheet, to keep track of the dates of inspections and also the frequency of the inspections.
Part 5	Safety Inspections Booking Request, This is a proactive request form that can make the need to schedule an inspection a thing of the past.
Part 6	Risk Management Implementation Plan, to assist with the allocation of responsibility for the rectification / control of hazards that have been identified.
Part 7	A Safe Work Method Statement (SWMS) sheet that is required to be completed prior to the commencement of any works.

With the changes that have occurred to the AS 1288 - 1994 we would recommend that you have a glazing audit performed to verify that the glazing that is installed within the property complies with the current standard AS1288 - 2006.

The teams at Roscon Property Services Pty Ltd are available to assist you with any and every essential safety measures concern that may eventuate and look forward to your call.

Thank you for your continued business.

Yours Sincerely

Roscon Property Services Pty Ltd

Paul Cummaudo
Managing Director
AREI, RBP, CRE, Licensed Estate Agent
Registered Building Practitioner DB-U 13329, CB-U 4272
Member REIV, MBAV, SCA, NCTI














Location

25 Bay Sample St Port Melbourne VIC 3207

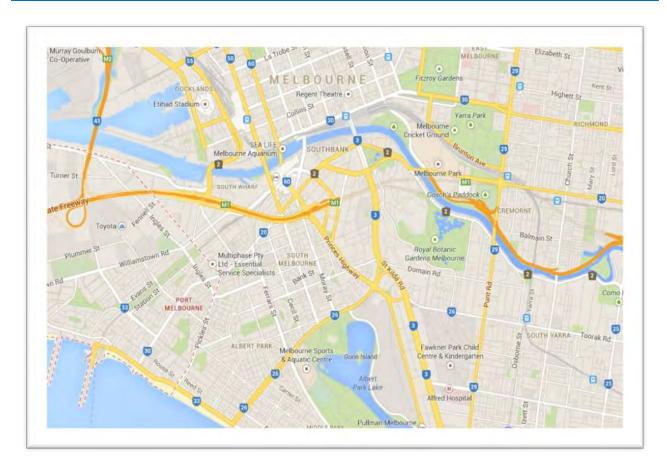













Priority Schedule – Risk Assessment

HIGH PRIORITY	Items listed under "High Priority" are items assessed as high risk of causing injury or death or are items located in high trafficable areas in which the probability of an injury is increased. It is strongly recommended that the items within this section to be rectified as soon as possible.
MEDIUM PRIORITY	Items listed under "Medium Priority" are items assessed as medium risk to the public, requiring maintenance or rectification as soon as practicably possible and prioritised after high priority issues have been rectified.
LOW PRIORITY / MAINTENANCE	Items listed under "Low Priority / Maintenance" are items assess as requiring maintenance as part of the buildings essential safety measures or general maintenance. These items include, lighting issues (including emergency & exit), paths of travel, missing fire suppression equipment, rubbish removal etc.
RECOMMENDATIONS	Items listed under "Recommendations" are items recommended to improve the current safety levels within the common areas. These items are not necessarily deemed hazardous, they are simply recommendations that will improve safety and benefit the occupants.

Inspection Notes

Generally there were few major hazards identified within the common areas of the building with the items identified not requiring major rectification works. The building in general has a minimal safety issues and the majority of items listed within are maintenance items or recommendations to improve safety throughout the building.

NOTE:

- o Five storey commercial development
- o One undercover car park
- o One open air car park
- o Metal deck roof.
- o Glass façade.
- o Two lifts.
- o Male, Female and Disabled toilets on each level.













Part 1: Detailed Safety Report

	High Priority			
Item	Details		Photographic Details	
1. Quote:	Hazard: • Yes • No • NA Location: Roof Level. Finding: Extreme safety dangers for anyone accessing the roof area. Two anchor points on the north and south walls were observed, however the east and the west walls have no anchor points.			
Proceed:	Auditor's Recommendation: To engage a suitable qualified contractor to install additional anchor points adjacent to the east and the west walls.			
No Action:	Auditor's Risk Assessment:		Cost Estimate: \$0 to \$500 \$501 to \$1000 \$1001 to \$1500 \$1501 to \$2000 >\$2001 	













	High Pri	ority	
Item	Details		Photographic Details
2.	Hazard: • Yes • No • NA Location: Car park 30.		
Quote:	Finding: Owner/tenant that utilises the car park has no vision of cars coming in/out of the car park. This could result in an accident with the vehicles entering or exiting the car park.		
Proceed:	Auditor's Recommendation: To engage a suitable qualified contractor to install convex parking mirror on the rear wall as indicated, so the owner/tenant utilising the car park can have a clear view on the vehicles entering or exiting from the car park.		
No Action:	 Auditor's Risk Assessment: Maintenance Required Risk of Injury Risk of Serious Injury Risk Of Death 		Cost Estimate: ● \$0 to \$500 □ ● \$501 to \$1000 □ ● \$1001 to \$1500 □ ● \$1501 to \$2000 □ ● >\$2001 □
3. Quote: Proceed:	■ Yes ■ No ■ NA Location: Roof level entrance. Finding: The door is not self — locking, subsequently anyone can enter the roof area. Also, appropriate door signage missing. Auditor's Recommendation: To engage a suitable qualified contractor to install a self locking mechanism on the door to avoid unauthorised people accessing to the roof level. Also, install appropriate signage 'Authorised Personnel Only'.		
No Action:	Auditor's Risk Assessment: Maintenance Required Risk of Injury Risk of Serious Injury Risk Of Death		Cost Estimate: ● \$0 to \$500 □ ● \$501 to \$1000 □ ● \$1001 to \$1500 □ ● \$1501 to \$2000 □ ● >\$2001 □













	Medium F	Priority	
Item	Details		Photographic Details
4.	Hazard: • Yes • No • NA Location: Walkway adjacent to open car park entry.		
Quote:	Finding: Raised concrete pit, which is a tripping hazard. Auditor's Recommendation: To engage a suitable qualified contractor to build up the mulch to the finished floor level of the concrete pit, to eliminate the trip hazard.		
No Action:	 Auditor's Risk Assessment: Maintenance Required Risk of Injury Risk of Serious Injury Risk Of Death 		Cost Estimate: • \$0 to \$500 • \$501 to \$1000 • \$1001 to \$1500 • \$1501 to \$2000 • >\$2001
5.	Hazard: • Yes • No • NA Location: Garden bed adjacent to the cafe on Plenty Road. Finding:		
Proceed:	Auditor's Recommendation: To engage a suitable qualified contractor to build up the mulch to the finished floor level of the concrete pit, to eliminate the trip hazard.		
No Action:	Auditor's Risk Assessment:		Cost Estimate: ● \$0 to \$500 □ ● \$501 to \$1000 □ ● \$1001 to \$1500 □ ● \$1501 to \$2000 □ ● >\$2001 □













	Medium I	Priority	,
Item	Details		Photographic Details
Quote:	Hazard: • Yes • No • NA Location: Cafe entrance on Plenty Road. Finding: Visible signs of water pooling as the concrete level is grated towards the bottom of the ramp, causing a slip hazard. Auditor's Recommendation: To engage a suitable qualified contractor to screed concrete to make the concrete fall towards the garden bed.		
No Action:	Auditor's Risk Assessment: Maintenance Required Risk of Injury Risk of Serious Injury Risk Of Death		Cost Estimate: ● \$0 to \$500 □ ● \$501 to \$1000 □ ● \$1001 to \$1500 □ ● \$1501 to \$2000 □ ● >\$2001 □
7. Quote: Proceed:	Hazard: • Yes • No • NA Location: Driveway adjacent to the car park entrance. Finding: Garden sleepers do not continue to the end of the ramp causing a trip hazard. Auditor's Recommendation: To engage a suitable qualified contractor to install additional garden sleepers until the end of the fence.		
No Action:	Auditor's Risk Assessment:		Cost Estimate: ● \$0 to \$500 □ ● \$501 to \$1000 ☒ ● \$1001 to \$1500 □ ● \$1501 to \$2000 □ ● >\$2001 □













	Medium I	Priority	
Item	Details		Photographic Details
8. Quote:	Hazard: • Yes • No • NA Location: Both the car park entrances. Finding: Exit signs not clearly visible due to roller door frame/motor.		
Proceed:	Auditor's Recommendation: To engage a suitable qualified contractor to relocate the exit signs in front of the frame/motor, so they are clearly visible.		
No Action:	Auditor's Risk Assessment:		Cost Estimate: • \$0 to \$500 • \$501 to \$1000 • \$1001 to \$1500 • \$1501 to \$2000 • >\$2001













	Medium Priority			
Item	Details		Photographic Details	
9. Quote: Proceed:	Hazard: • Yes • No • NA Location: Fibre optic cable tray adjacent to car park 29. Finding: Metal sheeting causing a trip hazard. Auditor's Recommendation: To engage a suitable qualified contractor to install two bollards with reflective tapes around the bollards so that cars may not hit the cable tray, which may interrupt the internet services of the whole complex.			
No Action:	Auditor's Risk Assessment:		Cost Estimate: • \$0 to \$500 □ • \$501 to \$1000 □ • \$1001 to \$1500 □ • \$1501 to \$2000 □ • >\$2001 □	
Quote:	Hazard: • Yes • No • NA Location: Sewage pipe adjacent to car park 13 & 21. Finding: Sewage leakage around the pipe, causing a slip hazard and unhygienic for people accessing the area. Auditor's Recommendation: To engage a suitable qualified contractor to rectify the sewage leak.			
No Action:	 Auditor's Risk Assessment: Maintenance Required Risk of Injury Risk of Serious Injury Risk Of Death 		Cost Estimate: ● \$0 to \$500 □ ● \$501 to \$1000 □ ● \$1001 to \$1500 □ ● \$1501 to \$2000 □ ● >\$2001 □	













	Medium I	Priority	,
Item	Details		Photographic Details
Quote:	Hazard: • Yes • No • NA Location: Roof Entrance. Finding: Missing appropriate signage on the door. Resulting in patrons/contractors accessing the area without realising the dangers.		
Proceed:	Auditor's Recommendation: To engage a suitable qualified contractor to install 'Authorised Personnel Only' signage.		112 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
No Action:	Auditor's Risk Assessment:		Cost Estimate: • \$0 to \$500 • \$501 to \$1000 • \$1001 to \$1500 • \$1501 to \$2000 • >\$2001
Quote:	Yes No NA Location: Roof level entrance catwalk. Finding: The support rails of the mechanical air handling systems are very low and this is the only access to the roof area. Patrons/contractors may collide with the top rail. Auditor's Recommendation: To engage a suitable qualified contractor to install cushioning and reflective tape along the support rails.		
No Action:	 Auditor's Risk Assessment: Maintenance Required Risk of Injury Risk of Serious Injury Risk Of Death 		Cost Estimate: • \$0 to \$500 • \$501 to \$1000 • \$1001 to \$1500 • \$1501 to \$2000 • >\$2001













	Medium F	Priority	
Item	Details		Photographic Details
13.	Hazard: • Yes • No • NA Location: Roof Entrance. Finding: The mechanical air handling system is very low.		
Proceed:	Patrons/contractors may collide with the bottom of the system. Auditor's Recommendation: To engage a suitable qualified contractor to install cushioning and reflective tape along the mechanical air handling system.		
No Action:	 Auditor's Risk Assessment: Maintenance Required Risk of Injury Risk of Serious Injury Risk Of Death 		Cost Estimate: ● \$0 to \$500 ☑ ● \$501 to \$1000 ☐ ● \$1001 to \$1500 ☐ ● \$1501 to \$2000 ☐ ● >\$2001 ☐
Quote:	Hazard:		
No Action:	To engage a suitable qualified contractor to raise the drain grate to match the finish floor level. Auditor's Risk Assessment: Maintenance Required Risk of Injury Risk Of Death		Cost Estimate: • \$0 to \$500 ✓ • \$501 to \$1000 ✓ • \$1001 to \$1500 ✓ • \$1501 to \$2000 ✓ • >\$2001 ✓













	Medium I	Priority	,
Item	Details		Photographic Details
15.	Hazard: • Yes • No • NA Location: Roof level.		
Quote:	Finding: The clips holding the flooring are loose, which presents as a fall hazard, if one of the flooring components was to dislodge.		
Proceed:	Auditor's Recommendation: To engage a suitable qualified contractor to secure all the loose clips.		
No Action:	 Auditor's Risk Assessment: Maintenance Required Risk of Injury Risk of Serious Injury Risk Of Death 		Cost Estimate: \$0 to \$500 \$501 to \$1000 \$1001 to \$1500 \$1501 to \$2000 >\$2001
16.	Hazard: • Yes • No • NA Location: Electrical meter cabinets on each level.		
Quote:	Finding: The cabinets do not have locking mechanism, giving access to the general public to the electrical switchboard.		COMMUNICATE
Proceed:	Auditor's Recommendation: To engage a suitable qualified contractor to install locks on all the electrical meter cabinets to eliminate unauthorised people being able to access the area.		ALCO AND
No Action:	 Auditor's Risk Assessment: Maintenance Required Risk of Injury Risk of Serious Injury Risk Of Death 		Cost Estimate: ● \$0 to \$500 □ ● \$501 to \$1000 □ ● \$1001 to \$1500 □ ● \$1501 to \$2000 □ ● >\$2001 □













	Low Priority/N	Vlaintenance		
Item	Details		Photographic Details	
Quote:	Hazard: • Yes • No • NA Location: Garden bed along the driveway entrance for the car parks. Finding: Exposed timber with protruding nails, causing a trip hazard. Auditor's Recommendation: To engage a suitable qualified contractor to			
No Action:	remove the two redundant timbers. Auditor's Risk Assessment: Maintenance Required Risk of Injury Risk of Serious Injury Risk Of Death		Cost Estimate: • \$0 to \$500 □ • \$501 to \$1000 □ • \$1001 to \$1500 □ • \$1501 to \$2000 □ • >\$2001 □	
Quote:	Hazard: • Yes • No • NA Location: Garden bed along the walkway on Plenty Road. Finding: Exposed irrigation pipe causing a trip hazard. Auditor's Recommendation:			
No Action:	To engage a suitable qualified contractor to rectify the irrigation pipe so it is not exposed. Auditor's Risk Assessment: Maintenance Required Risk of Injury Risk of Serious Injury Risk Of Death		Cost Estimate: ● \$0 to \$500 □ ● \$501 to \$1000 □ ● \$1001 to \$1500 □ ● \$1501 to \$2000 □ ● >\$2001 □	













	Low Priority/Maintenance			
Item	Details		Photographic Details	
19.	Hazard: • Yes • No • NA Location: Garden bed adjacent to letter box.			
Quote:	Finding: Pit in the garden bed, which presents as a potential tripping hazard.			
Proceed:	Auditor's Recommendation: To engage a suitable qualified contractor to build up the garden bed mulch to match the finish floor level.			
No Action:	 Auditor's Risk Assessment: Maintenance Required Risk of Injury Risk of Serious Injury Risk Of Death 		Cost Estimate: \$0 to \$500 \$501 to \$1000 \$1001 to \$1500 \$1501 to \$2000 >\$2001 	
20.	Hazard: • Yes • No • NA Location: Garden bed adjacent to the cafe entrance on Plenty Road.			
Quote:	Finding: Pit in the garden bed, which presents as a potential tripping hazard.			
Proceed:	Auditor's Recommendation: To engage a suitable qualified contractor to build up the garden bed mulch to match the finish floor level.			
No Action:	 Auditor's Risk Assessment: Maintenance Required Risk of Injury Risk of Serious Injury Risk Of Death 		Cost Estimate: \$0 to \$500 \$501 to \$1000 \$1001 to \$1500 \$1501 to \$2000 >\$2001 \$1501 to \$2000 \$2001 	













Low Priority/N			Maintenance		
Item	Details		Photographic Details		
21.	Hazard: • Yes • No • NA Location: Roof Level.				
Quote:	Finding: Fire extinguisher signage missing. Auditor's Recommendation: To engage a suitable qualified contractor to install the required signage.				
No Action:	 Auditor's Risk Assessment: Maintenance Required Risk of Injury Risk of Serious Injury Risk Of Death 		Cost Estimate: • \$0 to \$500		
22.	Hazard: • Yes • No • NA Location: Access control pillar adjacent to the car park entrance.				
Quote:	Finding: Exposed electrical cabling. Auditor's Recommendation: To engage a suitable qualified contractor to rectify so the electrical cabling is not exposed.				
No Action:	 Auditor's Risk Assessment: Maintenance Required Risk of Injury Risk of Serious Injury Risk Of Death 		Cost Estimate: • \$0 to \$500 □ • \$501 to \$1000 □ • \$1001 to \$1500 □ • \$1501 to \$2000 □ • >\$2001 □		













	Low Priority/Maintenance			
Item	Details		Photographic Details	
23.	Hazard: • Yes • No • NA Location: Garden bed adjacent to bin area.			
Quote:	Finding: Exposed redundant electrical conduit and bolts, which presents as a tripping hazard.			
Proceed:	Auditor's Recommendation: To engage a suitable qualified contractor to remove the electrical conduit and concrete pad with bolts, if it is not going to be utilised.			
No Action:	 Auditor's Risk Assessment: Maintenance Required Risk of Injury Risk of Serious Injury Risk Of Death 		Cost Estimate: ● \$0 to \$500 □ ● \$501 to \$1000 □ ● \$1001 to \$1500 □ ● \$1501 to \$2000 □ ● >\$2001 □	
24.	Hazard: • Yes • No • NA Location: Bin area.		II MUST BEFE	
Quote:	Finding: The bin area lock is not suitable for areas with high wind. It is evident by the holes on the door that this lock has been broken twice before.			
Proceed:	Auditor's Recommendation: To engage a suitable qualified contractor to install a heavy duty locking mechanism onto the door.			
No Action:	 Auditor's Risk Assessment: Maintenance Required Risk of Injury Risk of Serious Injury Risk Of Death 		Cost Estimate: • \$0 to \$500 • \$501 to \$1000 • \$1001 to \$1500 • \$1501 to \$2000 • >\$2001	













Low Priority/Maintenance			
Item	Details		Photographic Details
25.	Hazard: • Yes • No • NA Location: Male toilet door on level 1. Finding: Loose air vent.		
Proceed:	Auditor's Recommendation: To engage a suitable qualified contractor to rectify the air vent on to the door.		
No Action:	 Auditor's Risk Assessment: Maintenance Required Risk of Injury Risk of Serious Injury Risk Of Death 		Cost Estimate: ● \$0 to \$500 ● \$501 to \$1000 □ ● \$1001 to \$1500 □ ● \$1501 to \$2000 □ ● >\$2001 □













Recommendations			
Item	Details		Photographic Details
26.	 Yes No NA Location: Gas meter adjacent to the cafe. Finding:		
Quote:	No locks installed, giving general public access to the gas meter. Auditor's Recommendation: To engage a suitable qualified contractor to install a cage with lock around the gas meter.		
No Action:	 Auditor's Risk Assessment: Maintenance Required Risk of Injury Risk of Serious Injury Risk Of Death 		Cost Estimate: • \$0 to \$500 • \$501 to \$1000 • \$1001 to \$1500 • \$1501 to \$2000 • >\$2001
27. Quote:	Hazard: • Yes • No • NA Location: Water meter adjacent to the driveway entrance. Finding:		
Proceed:	General public can easily access the water meter. Auditor's Recommendation: To engage a suitable qualified contractor to install a cage with lock around the water meter.		
No Action:	 Auditor's Risk Assessment: Maintenance Required Risk of Injury Risk of Serious Injury Risk Of Death 		Cost Estimate: • \$0 to \$500 • \$501 to \$1000 • \$1001 to \$1500 • \$1501 to \$2000 • >\$2001













Part 2: Contractors Working Agreement

Read carefully and prior to signing

1. Introduction

Safety is everybody's business. It is the responsibility of everyone to be proactive with safety. If you see a Hazardous situation

- Fix it,
- Inform the persons(s) responsible,
- Report it to the Committee, Caretaker or Owners Corporation Manager
- Don't leave the hazard until you have taken preventative measures to isolate the hazard
- In the case of not being able to fix the situation leave the area in a manner that the hazard is clearly visible with indication of the hazard.

If you are unsure of the correct and safe way of doing a job, ask, don't take chances. The right commitment and attitude to safety is required.

2. Reporting Injuries and Accidents

Each occupational Injury or Illness, however small, must be reported immediately to the Body Corporate Manager. All accidents involving damage to property, equipment and materials, including motor vehicle accidents that occur on the property of the Body Corporate must be immediately reported to the Body Corporate Manager.

3. Conduct

No contractor shall present themselves for work under the influence of alcohol or drugs. These people are a hazard to themselves and others.

3.1. Alcohol

No contractor shall be allowed to bring any alcoholic beverages or non-prescribed drug onto site at any time.

3.2. Fighting

Fighting on site will not be allowed.

4. Personal Protection

All contractors that are employed to work on Body Corporate property are obligated to

Provide any and all personal protective equipment necessary to perform their works and to ensure the safety of their employees and the general public.

Use all necessary equipment to perform the works in the safest manner possible, including but not limited to:

- Ladders
- Scaffolding
- Scissor lift / Boom
- Safety harness, inertia reels, restraint lines
- Perimeter handrails / fall protection
- Isolation barriers and temporary fencing
- Hearing protection must be worn wherever high noise levels have been identified; ex. Jackhammer, grinding, explosive power tools, pile driving, impact tools.
- Eye protection is compulsory in designated eye protection areas, or when using power tools or machinery mowers etc, or when in the vicinity of electric arc welding.













- Wear the appropriate gloves when handling any materials or substance which might cause harm to your hands.
- Use filter masks or the appropriate respirators in dusty or fume filled conditions.
- Sun protection cream with an appropriate UV level should be worn when working outside.

5. Housekeeping

Good housekeeping on Body Corporate property is mandatory, and every Contractor must do his part daily in this activity to keep the property clean for the reasons of safety and efficiency. Materials should be stored in designated areas and in a manner that does not impede the access to and from the property.

6. Tools & Equipment

Tools and equipment that is used on Body Corporate property will be in good order and condition with all of the necessary guards in place and in a fully operation al condition,. No tool or equipment will be used in a manner that does not comply with the requirements of the manufacturer.

7. Electricity

All portable and semi-portable, electrical equipment should be tested by a Certified Electrician and a label fixed to equipment showing date of inspection and equipment plant number. Details of the inspections should be recorded and be available upon request.

7.1. Electrical Contractors

Electrical installations are to be performed compliant to and in accordance with the Australian Standard 3000:2000 (SAA Wiring Rules) and are tested and connected in accordance with recognised procedures, using suitable testing equipment.

7.2. Isolation and danger tagging

Before working on any electrical equipment it must be isolated from power, and/ or the correct locking and / or danger tagging procedure following where applicable.

7.3. Power leads

Keep all power leads off the ground or floor where practical and place them so that they cannot be damaged. Electric leads must be properly earthed and must not exceed 30m in length. Double adaptors and piggy back plugs must not be used.

8. Manual Handling

Utilize good manual handling techniques to perform the works that you have been engaged to complete. Utilize mechanical equipment that is appropriate for the task that is at hand.

9. Working at Height

When a contractor is required to work at height, preventative steps will be taken to minimize the risk of fall. The requirements of the Occupational Health & Safety (prevention of Falls) Regulations 2004 and use the "hierarchy of control of risk's" as per Part 2 Regulation 205 to control the risk of falls.

10. Ladders

Only approved ladders shall be used. They shall comply with relevant Australian Standards or a code of practice approved under relevant legislation. No electrically conductive ladder shall be used around live power cables.













10.1. Before Use

Before using any ladder, check for faulty rungs or side rails. Do not use if damaged. Approved Australian Standard markings must be affixed to all approved ladders.

10.2. Positioning

A ladder should be placed with its foot approximately one quarter of its length away from the wall or construction to be accessed. Where possible, place the ladder clear of walkways and traffic ways.

10.3. Condition

Keep ladders in good condition, position them in a safe manner and extend them a minimum of one metre beyond the landing place. All ladders must be tied or other wise secured in position at the top and bottom. The ladder must be held at the base by an assistant while the ladder is being secured.

10.4. Planks

No ladders shall be used to support planks.

10.5. Scaffolds

All scaffolds shall be erected, altered or dismantled strictly in compliance with the relevant scaffolding regulations using authorised and fully trained persons only.

10.6. Access

Ladder access shall be provided to, and made secure at, every platform working level.

10.7. Wheels

Always check that wheels of a mobile scaffold are locked before using the scaffold. No person is to be on a mobile scaffold when it is being moved.

11. Hazardous Substances / Chemicals

When using chemicals or hazardous substances, Material Safety Data sheets will be acquired from the manufacturers and will be available for viewing, the requirements of the Material Safety Data sheets will be complied with in full. All hazardous substances will be used compliant to the Occupational Health & Safety (Hazardous substances) Regulation 1999.

12. Warning Signage

Warning signs should be used when there is a need to warn people of the hazardous events that are taking place. Events such as explosive power tools, risk of things falling from above, equipment or plant that is out of order, scaffold that is incomplete etc.

13. Excavations and Trenches, Pits and Shafts

Trenches over 1.5 metres deep in all materials shall be sloped/ battered or shored in an approved manner or in accordance with relevant legislation and codes of practice.

13.1. Ladders

In each trench one metre deep or more where employees are working, ladders shall be provided in accordance with relevant legislation and codes of practice to provide safe egress from trench.

13.2. Inspection

Excavations and trenches shall be inspected daily by a competent person. If there is evidence of slides or cave-ins, all work in the exposed area shall cease until necessary precautions have been taken for the protection of the employees.

13.3. Guards

Protect all openings into shafts, ducts, stairs or lift wells with substantial full height guards. Do not remove them, without authority.













13.4. Covers

Protect all pits, shafts or floor penetrations with secured covers.

13.5. Below the work space

When working in shafts or in lift or stairwells, ensure that there are no workmen below. Prior to the commencement of the works take all necessary steps required to isolate the area, install barriers and notices to stop access below the work space. Provide fully trained spotters to maintain the safety of the area below the work space.

13.6. Jumping

Do not jump down from platforms or into trenches. Use ladders or steps.

13.7. Openings

Excavations, floor openings or holes shall be protected by approved guard rails or covers. If covers are used they must be used in conjunction with steel mesh of an approved size built into the hole or opening. The covers shall be strong enough to support the loads imposed upon them, shall be secured to prevent accidental displacement and should be marked "DANGER HOLE BENEATH"

14. Protrusions

Protruding nails, tie down bolts, reinforcing rods, mesh bars, tubing, conduit, flashing materials, cabling etc. are removed, bent over, flagged or guarded to eliminate / reduce the risk of injury.

15. Task Lighting

Provide task lighting that is required to perform the works or to permit safe travel through the property.

16. Crane or Hoist Work

Obey any instructions given by a Dogman, Crane Chaser or Rigger who is directing crane operations on Body Corporate property. Only certified or permitted persons are allowed to carry out slinging operations and direct crane movements.

17. First Aid

A compliant and fully equipped first aid kit will be provided by the contractor and will be maintained within the workplace.

18. Fire Control

Fire equipment will be available when there is a potential risk of fire; flammable paints and / or liquids are used or stored. No works will be performed that contravene a total fire ban.

19. Licences

Ensure that appropriate licences and certificates of competency are held for the required performance of the works.

20. Vehicles, Plant and Equipment

No person shall drive or operate any vehicle, plant mobile or other equipment, unless they posses the appropriate certificate or permit.

DO NOT USE any vehicle, plant or equipment for which you do not know the correct procedures for safe operation. You must not operate any vehicle, plant or equipment, which you are not confident that you can effectively control or have not been adequately trained to operate.













21. Insurances

Ensure that all of the applicable insurances are in force and are current at all times, workers compensation, public liability, professional indemnity etc. A certificate of currency is to be provided prior to the commencement of the works.

Company Name				
Contractors Name				
Licence Number (if applicable)Type of licence	ē			
Contractors Signature	.Date	/	/	
Witness Signature	Date	/	./	













Part 3: Sub-Contractors Application

1. The Applicant:

Trading name (Sole trader / Partnership /	Company)			
Business Address Post Code				
ACN:	ABN:	Established Since:		
Type of business / Trade (eg: Plumber, Electrician, Handyman, Gardener, Painter)				

2. Names of Partners & Directors

Full Name	Address	Qualification or Experience

3. Telephone Numbers & Insurance Details

Phone: Business	Mobile:	Facsimile:	
License Number: (If Applicable)	Do you belong to any Trade Organisations? Yes / No (please circle) Name Of Organisations:	Years of Experience in Trade:	
Do You Hold Public Liability Insurance? Yes / No (please circle)	Name of Insurer:	Policy Number: Expiry Date:	
Do You Hold Workers Compensation Insurance? Yes / No (please circle)	Name of Insurer:	Policy Number: Expiry Date:	
Do You Hold Professional Indemnity Insurance? Yes / No (please circle)	Name of Insurer:	Policy Number: Expiry Date:	

Do have email facilities: **Yes / No** (please circle) If **Yes** do you prefer to be notified by email **Yes / No** (please circle) Your email address:

NOTE TO CONTRACTORS

PLEASE ATTACH A COPY OF CERTIFICATES OF CURRENCY FOR WORKERS COMPENSATION, PROFESSIONAL INDEMNITY AND PUBLIC LIABILITY INSURANCE, COPY OF ALL RELEVANT LICENSES AND A COPY OF A WORKSAFE VICTORIA TICKET-RED.

* Note: It is advisable that a new agreement be signed by all contractors annually













4. Insert Work Rates & Other Information Required

•	
Initial call out fee (If applicable)	\$
Hourly rate	\$
Do you charge for quotes?	Yes / No (please circle)
What is your response time?	
Do you work weekends?	Yes / No (please circle)
Do you work after these hours 7:00 AM to 6:00 PM?	Yes / No (please circle)
Are you prepared to attend emergency situations at any time Yes / No (please circle) if Yes	Hourly Rate applicable \$
Number of people employed in your business?	Full Time Part Time
Do you use Sub-Contractors?	Yes / No (please circle)
When you take holidays does your business still operate? Yes / No (please circle)	If you take regular holidays state here times when you will not be able to attend to any work
If you use Sub-Contractors do you ensure they have Public Liability Insurance?	Yes / No (please circle)
What radius do you cover from your Business address?	Km
What Municipalities do you cover?	Name municipalities
Which vehicle/s will be used to attend to jobs?	Year: Make/Model: Registration:
Does your vehicle advertise your business name?	Yes / No (please circle)
What was your largest contract In the past 12months?	\$ Nature of Contract:
What was your business turnover (Last Financial Year)? (Only needs to be an estimate)	\$
Provide one business related reference (eg: Preferably some one you perform work on a regular basis)	Contact name:
Name or Company:	Buss Tel:
Address:	Mobile No:













5. Signature

Signed by applicant:	Signature of witness:
Print name of applicant:	Print name of witness:
	Address of witness:

Important Information:

The information provided herein will be kept strictly confidential in accordance with the Roscon Group of Companies Privacy Polices, which are available on request.

The Applicant understands that RPM is not under any obligation to provide any work to the applicant. Any work the applicant performs on behalf of RPM the applicant undertakes to perform such work in a good workman like manner. The applicant agrees to guarantee all work performed on behalf of RPM. All work carried out by the applicant will comply with Australian Standards and any other Industry Standards which may be applicable to the applicants business. The Applicant will at all times comply with Work Safe procedures and other Occupational Health and Safety Regulations. The Applicant, when performing work on behalf of RPM will dress in appropriate work clothing appropriate for that particular trade or business. RPM is a quality assured company and holds ISO–9000:2001 International Certifications and therefore expects its sub-contractors to display the same professionalism when carrying out work on behalf of RPM. The applicant will indemnify RPM and hold RPM indemnified from and against all actions, claims, demands, losses, costs, damages, and other expenses (including without limitation reasonable legal costs on a solicitor and own client basis) ("the loss") in relation to or arising from: (a) death, bodily injury or damage to property suffered by any person or persons whatsoever including members and occupiers of any property or part thereof which the applicant is carrying out works (b) except to the extend that the loss is caused or contributed to by RPM wilful act or negligence.

The Applicant whilst performing work on behalf of RPM shall not:

- Solicit work from any entity RPM has provided to the applicant either directly or indirectly
- Solicit any person, Body Corporate or Company which RPM has provided a lead to the Applicant
- Promote their own individual business to clients of RPM
- Use machinery or tools which are not suitable or safe for a particular job













Part 4: Safety Inspections Notations Sheet

BUILDING NAME: (if applicable)	
STRATA PLAN NUMBER:	PS 643519U
SITE ADDRESS:	240 Plenty Road Bundoora VIC 3083

DATE OF INSPECTION:	INSPECTED	INSPECTORS ID
September 2013	HAR - 699	Roscon Property Services Pty Ltd
September 2014		
September 2015		
September 2016		

Safety Updates

It is a requirement of the Occupational Health & Safety Act 2004 that control measures be put in to force to minimize the risks to injury of workers, self employed persons and members of the public and further that these control measures be monitored for effectiveness on a regular basis.













Part 5: Safety Inspections Booking Request

PROPERTY ADDRESS:	
CONTACT(S):	
INSTRUCTIONS:	Perform an initial safety inspection
FOLLOW UP INSPECTION REQUIRED	Yes NO
FREQUENCY OF INSPECTION	6 MONTHLY YEARLY
REGULAR INSPECTIONS	REGULAR WHEN NOTIFIED / APPROVED
Authorisation	
PROCEED TO	SIGNED:
	DATED:
	•
AUTHORISED REPRESENTATIVE NAME	
PHONE NUMBER	













Part 6: Risk Management Implementation Plan

BUILDING NAME: (if applicable)	
STRATA PLAN NUMBER:	
SITE ADDRESS:	

Item to be Addressed	Person(s) to address item	Proposed implementation date	Job Complete Date	Review Date if applicable













Standard Procedures for Working at Heights

WHEN WORKERS OR CONTRACTORS ARE CLEANING GUTTERS, EXTERNAL WINDOWS, SKYLIGHTS, AND ROOFS OR PAINTING THE OUTSIDE OF A BUILDING THEY OFTEN ARE OPERATING AT HEIGHTS WHERE A FALL COULC CAUSE SERIOUS INJURY OR DEATH. HIGH WIND, RAIN, AND EQUIPMENT FAILURE MAY ALSO INCREASE THE RISK.

Assess the risk in your workplaces. To manage it, apply the hierarchy of controls.

A. ELIMINATION

If workers or contractors can avoid at heights, they should do so.

B. SUBSTITUTION

Wherever possible use extensions on cleaning equipment to reach high areas.

C. SEPARATION

Not a viable option

D. REDESIGN

Consider using specialised equipment such as:

- Scaffolding;
- Suspended Scaffolding;
- Elevating Work Platforms;
- Ladders:
- > Implement and document safe work practices in set -up, operating, and safe use of plant.
- For Example:
- Get on or off at a safe place;
- Follow Manufacturer's instructions;
- > Know the emergency procedures, e.g. how to lower suspended scaffolding in the event of a power failure;
- Ensure that fixed anchoring points are capable of supporting the load.

E. Other Controls

These controls should only be adopted where it is not possible to adopt the control measures at A), B), C) and D) above. Administrative controls and personal protective equipment are less effective and require more frequent reviews or hazards, systems of work, equipment and training. The condition of the roof and surrounds will require inspection prior to commencement to ensure it is safe and structurally sufficient. That intermediate supports for static lines d not exceed 6.0 –metre spacing unless specifically designed to do so.

F. ADMINISTRATION

Make sure equipment conforms to Australian Standards. Look for the AS compliance plate. Ensure only trained and certified people operate equipment. Have equipment checked and maintained regularly.

G. PERSONAL PROTECTION EQUIPMENT (PPE)

Consider all other control options first.

Provide safety devices (harness or belt) and train workers in their proper use ensure anchoring points are installed by an Engineer or other qualified person and ensure anchoring points are tested at least on once every 12 months by an Engineer who has experience and competence to assess the integrity of a building or structure an Anchorage point (AS 1891.4:2000).

Working from roofs is a complex issue; the above should be read by the Contractor in conjunction with the Contractors SWMS













TERMS AND CONDITIONS

The following information is very important and forms an integral part of this report.

Before you decide to purchase / occupy this property you should read and understand the following important information. It will help explain what is involved in a Standard Property Inspection, the difficulties faced by an inspector and why it is not possible to guarantee that a property is free of defects, latent or otherwise. This information forms an integral part of the report. The general adequacy of site drainage is not included in the Standard Property Inspection Report. Comments on surface water drainage are limited as where there has been either little or no rainfall for a period of time, surface water drainage may appear to be adequate but then during periods of heavy rain, may be found to be inadequate. Any comments made in this section are relevant only in light of the conditions present at the time of inspection. It is recommended that a Smoke Test be obtained to determine any illegal connections, blocked or broken drains

THIS IS A VISUAL INSPECTION ONLY AND IN ACCORDANCE WITH AS4349.1

This visual inspection is limited to those areas and sections of the property fully accessible and visible to the Inspector at the time and on the date of Inspection. The inspection DID NOT include breaking apart, dismantling, removing or moving objects including, but not limited to, foliage, mouldings, roof insulation/sarking membrane, floor or wall coverings, sidings, ceilings, floors, furnishings, appliances or personal possessions. The Inspector CANNOT see inside walls, between floors, inside skillion roofing, inside the eaves, behind stored goods in cupboards, or other areas that are concealed or obstructed. The inspector DID NOT dig, gouge, force or perform any invasive procedures. In an occupied property it must be understood that furnishings or household items may conceal defects which may only be revealed when the items are removed. No detailed inspection is inferred to external areas over 3.6 metres above the natural ground level.

SCOPE OF REPORT

The Standard Property Report is not intended as a certificate of compliance of the property within the requirements of any Act, regulation, ordinance or by-law, or, as a warranty or an insurance policy against problems developing with the building in the future.

LIMITATIONS

Nothing contained in the Report implies that any inaccessible or partly inaccessible area(s) or section(s) of the property being inspected by the Inspector on the date of the inspection were free from defects latent or otherwise.

No responsibility can be accepted for defects, which are latent or otherwise not reasonably detected on a visual inspection without interference with or removal of any of the structure including fixtures or fittings within the building. This Standard Property Report does not contain any assessment or opinion in relation to any item, which is the subject of a Special Purpose Property Report (as defined in AS4349.1), or any matter where the inspection or assessment of which is solely regulated by Statute. Special Purpose Property Reports include comment on the following: Common property areas, environmental concerns such as sunlight, privacy, streetscape and views. Proximity of property to flight paths, railways and busy traffic or other neighbourhood issues. Noise levels, health and safety issues including the presence of asbestos or lead. Heritage concerns. Security or fire protection. Analysis of site drainage apart from surface water drainage. Swimming pools and spas. Detection and identification of illegal and unauthorised building and plumbing work. Durability of exposed finishes.

IMPORTANT INFORMATION

Any person who relies upon the contents of this Report does so acknowledging that the above clauses, definitions and disclaimers that follow define the Scope and Limitations of the inspection and form an integral part of the report.













DISCLAIMER OF LIABILITY

No liability shall be accepted on account of failure of the Report to notify any problems in any area(s) or section(s) of the subject property physically inaccessible for inspection, or to which access for Inspection is denied by or to the Inspector (including but not limited to any area(s) or section(s) so specified by the Report.

DISCLAIMER OF LIABILITY TO THIRD PARTIES

This report is made solely for the use and benefit of the Client named on the front of this report. No liability or responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part does so at their own risk.

REPORT DEFINITION

This report is limited to a visual inspection of areas where reasonable access is available at the time of inspection. It does not purport to be geological as to foundation integrity or soil conditions, engineering as to structural, nor does it cover the condition of electrical, plumbing, gas or motorised appliances. It is strongly recommended that an appropriately qualified contractor check these services prior to purchase.

As the date if this report we have identified the items as listed herein, we do not accept any responsibility for items which may be damaged after the inspection has been completed.

As a matter of course, and in the interests of safety, all prospective purchasers should have an electrical report carried out by a suitably qualified contractor.

This report is limited to (unless otherwise noted) the main structure on the site and any other building, structure or outbuilding specifically named within the report.

This Report attempts to assist in judging a building according to its age and level of maintenance and in providing relative comparisons. This inspection and report is not to be considered all encompassing dealing with a building from every aspect. Rather it should be seen as a reasonable attempt to identify any significant defects visible at the time of the inspection. It is unrealistic to expect comment on minor defects or imperfections in the Standard Property Report. If this is required, a Special Purpose Property Report is recommended.

Whilst buildings may have many pleasing features there are few without defects and many are due naturally to age deterioration. Subject to the level of maintenance on the building it is common for the number of faults to have increased with age.

All items that are considered to be concealed or latent defects are excluded.

Shower Recesses: Tests may be made on shower recesses to detect leaks (if water is connected). The tests may not reveal leaks or show incorrect waterproofing if silicone liquid or masonry sealant has been applied prior to the inspection. Such application is a temporary waterproofing measure and may last for some months before breaking down. The tests on shower recesses are limited to running water within the recesses and visually checking for leaks. As showers are only checked for a short period of time, prolonged use may reveal leaks that were not detected at the time of inspection. No evidence of a current leak during inspection does not necessarily mean that the shower does not leak.

Glass Caution: Glazing in older houses (built before 1978) may not necessarily comply with current glass safety standards AS1288. In the interests of safety, glass panes in doors and windows especially in trafficable areas should be replaced with safety glass or have shatterproof film installed unless they already comply with the current standard.













Stairs & Balustrades: Specifications have been laid down by the Australian Building Code - Section 3.9 covering stairs, landings and balustrades to ensure the safety of all occupants and visitors in a building. Many balustrades and stairs built before 1996 may not comply with the current standard. You must upgrade all such items to the current standard to improve safety.

Swimming Pools: If a swimming pool is present it should be the subject of a Special Purpose Property Report. A detailed inspection on the status or serviceability of any swimming pool or associated pool equipment has not been carried out and is not within the scope of this report. Additionally, to adequately inspect a swimming pool, the water must be completely drained and all internal surfaces must be fully accessible.

This report may contain notable observations, together with what is considered to be helpful information and advice.

This report does not identify timber-destroying pests. A timber pest inspection report should be obtained from a qualified timber pest inspector.

If any cost of work estimates are given, these are merely opinions and should be taken as a general guide only. In the building industry, experience has shown that prices vary considerably and you must obtain independent quotations on any significant notable item from several contractors prior to purchase.

The operation of fireplaces, chimneys, alarm systems, intercom systems, electrical and mechanical appliances, air conditioning systems, smoke detectors and residual current devices have not been tested and are the subject of a Special Purpose Property Report. Should you require an inspection to be carried out on any item not specifically covered by this report, please request a Special Purpose Property Report on the specific item required.

No report is made on the presence, operation, installation or cabling of any free to air or pay television system.

LIGHTING INSTALLATIONS

It should be noted that this inspection was done during daylight hours and therefore the adequacy of lighting in darkness could not be directly assessed.

ELECTRICAL INSTALLATIONS

We have carried out a thorough visual inspection of the common property and assets visible from the common property areas. If there were any visible electrical installation issues they have been included in this section of the report. We have not carried out a thorough inspection of electrical installation and the main switchboard, as we are not qualified to do so, please ensure that a suitably qualified electrical contractor carries out a thorough visual inspection at least every 2 years, this inspection can be incorporated with the testing of the Residual Current Device if Community Circuits are present.

PLUMBING, GUTTERS & DOWNPIPES AND ROOFS

We have carried out a thorough visual inspection of the common property and assets visible from the common property areas. If there were any visible plumbing, gutters and downpipes or roof issues they have been included in this section of the report. We have not carried out a thorough inspection of the plumbing, gutters and downpipes and roof, as we are not qualified to do so, please ensure that a suitably qualified plumbing contractor (who is qualified to undertake roof inspections) carries out a thorough regular inspection. We will recommend a qualified plumber to inspect if an issue is found.

LIFTS

Please ensure that if lifts are in the building(s) that regular maintenance programs are in place. This report does not cover lifts.













PAINTING

Painting surfaces not exposed to the elements/corrosion should be included in the next painting cycle. Painting for astatic purposes is not included in this report.

AIR CONDITIONING

Only a general external inspection of air conditioning units is carried out where installed, therefore please ensure that if the Body Corporate has air conditioner(s) in the building(s) they have regular maintenance programs in place. This report does not cover air conditioning units and air condition cooling towers.

GLASS

This report only addresses glass requiring obvious replacement; It does not cover the Building Code, Australian Standard and safety requirements of glass installed in the common property.

PLANT AND EQUIPMENT

Please ensure that if the Body Corporate has plant and equipment in the building(s) that regular maintenance programs are in place for each piece of plant and equipment. This report does not cover plant and equipment.

BALCONY BALUSTRADES

Wherever balcony balustrades are installed, please be advised that a comprehensive inspection of balcony railings was not carried out as part of this report. Also this report is only a visual inspection of areas accessible from the common property, therefore all balcony balustrades are not viewed. If there are any visible signs of corrosion on the balustrade including fixings and/or if the balustrades are over 10 years old a detailed inspection and testing of balustrades should be undertaken.

PEST REPORTS

If there are any visible signs of termite damage it is included in this report. We have not carried out a pest inspection of the site; as we are not qualified to do so, please ensure that a suitably qualified pest inspection contractor carries out thorough regular inspections.

FIRE FIGHTING EQUIPMENT AND STATUTORY REQUIREMENTS

It has been assumed that any building needing fire fighting equipment to meet legislative requirements such as the Building Code of Australia 1996 did meet those requirements at the time of construction. We have not examined the fire safety requirements for the building and make no comment as to the adequacy of the measures found in the complex. We have not and do not assess the condition of any fire fighting equipment within the complex. If the Bodies Corporate wishes to ascertain its position with respect to fire safety compliance it may carry out its own assessment. We have provided you with a proposed set of Guidelines For Fire Evacuation in Section 4 of this report. These guidelines should be placed on the Body Corporate notice board. We have visually inspected the fire fighting equipment but have not carried out any testing and therefore cannot determine if the equipment has been tampered with or will be effective in case of fire.

Rooms below ground level: If there are any rooms under the house or below ground level (whether they be habitable or non-habitable rooms), these may be subject to dampness and water penetration. Drains are not always installed correctly or could be blocked. It is common to have damp problems and water entry into these types of rooms, especially during periods of heavy rainfall and this may not be evident upon initial inspection. These rooms may not have council approval. The purchaser should make their own enquiries with the Council to ascertain if approval was given. Where the property is covered by an Owners Corporation (Strata Title), we strongly recommend that an Owners Corporation search be conducted to ascertain the financial position, the level of maintenance and any other relevant information available through the conduct of such an inspection.













SERVICES

Important Notes: In regard to plumbing or electrical, it should be noted that we are not plumbers or electricians and any comment made is not that of a qualified plumber or electrician. We recommend that a qualified contractor be engaged to make comment on any matter dealing with plumbing or electrical issues.

COST ESTIMATE

The cost estimates that are provided within this report are the opinion of the inspector who performed the inspection. The cost estimate that is indicated, relates to the item that has been detailed within the report, allowance has been made for multiple item(s) that were observed at the time of the inspection and have not necessarily been detailed within the report. It is advised that applicable requests for quotation be called to provide an accurate costing of the works required, to make good the areas that were apparent at the time of the inspection. Although every effort has been taken to provide an accurate cost estimate, Roscon Group cannot guarantee that the written quotation will reflect the value indicated within the cost estimate.

Roscon Property Services

Offices 150 Sydney Road Coburg VIC 3058 Level 50, 120 Collins Street Melbourne VIC 3000 Tel 1800 767 266 Lemail info@roscon.com Web roscon.com.au













Safe Work Method Statement

Job Task:	Building Name
	Strata Plan Number
	Site Address

RISK IDENTIFICATION AND CONTROLS

Please include all discrete steps involved in the performance of the task chemical must be listed and the minimum PPE for each chemical must be listed as per the relevant MSDS.

R1 Risk without controls

R2 Risk with controls

Procedural step(s)	Possible hazard(s)	R1	Safety control(s)	R2
	Overall risk rating		Overall risk rating	













RISK RATING GUIDE

		Consequence				
		Death Catastrophic Illness/Injury	Major Extensive Injuries	Moderate Medical treatment required	Minor No injuries	
	Almost certain Occurred before/expected	Н	Н	S	S	
	Likely Probably will occur	Н	S	S	S	
Likelihood	Moderate May occur at some time	Н	S	L	L	
	Unlikely Unusual or rare situation	S	L	L	L	

High (H) – cease exposure immediately until protection, approved at senior management level, implemented.

Significant (S) – procedures alone may not be enough, senior management attention required.

Low (L) – may be managed by routine procedures, some risks in this category may be acceptable.













SPECIFIC	TVCK D	EULIIDI	ENTENTS
3F LCIFIC	. IASK N	LOUIN	LIVILIVIS

Qualifications or experience •	
Training •	
Engineering details, certificates, Work Cover approvals •	
Relevant codes of practice, legislation or standards Occupational Health & Safety Act 2000 Occupational Health & Safety Regulation 2001	
Plant/equipment •	
Maintenance checks, site/workplace inspections •	

Suggested improvements (in order or priority)

Additional comments













Initial assessment date		Current assessment date	Reassessment due date
Assessors			
Name		Signature	Date
•		•	
•		•	
•		•	
Recommendation [្រ Follow ប	up required	
Name		Signature	Date
•		•	
Approval			

Signature

I have read and understand this Safe Work Method Statement

Name / Role	Signature	Date

Name / Role	Signature	Date

Date





Assessment dates

Name





